

## PRODUCT CHANGE NOTIFICATION (PCN)

<b>PCN#</b>	WPC-191202-001	<b>Issuing Date</b>	Dec 02 <sup>th</sup> , 2019
-------------	----------------	---------------------	-----------------------------

**PRODUCT(S) AFFECTED :**

**Attachment:** Yes No

Product Name	Description	Supplying Schedule
WIZ750SR-TTL/232/485 WIZ750SR-100/105/110 W7500S2E/W7500P-S2E	F/W 1.2.4→1.3.1	From Dec 02 <sup>th</sup> , 2019

**Description of Changes from Firmware Ver 1.2.7 to Ver 1.3.1**

- Bug Fixed
  - Incorreceted pin mapping - HW\_Trigger Pin of WIZ750SR-110
  - When serial data packing 'time' option is less than 500ms, the first serial data(+++) ignored in GW mode.
  - When UART Tx/RX cross connect and Received UART data size more than 3, UART data don't send
  - DHCP Lease Time : when DHCP\_DEBUG enable, DHCP Lease Time is fixed as 10 second.
  - The Status LED(PA\_07) of WIZ750SR\_1xx doesn't operate.
  
- Improvements
  - Use the multicasting operation
  - While IP address is allocating using DHCP, the device can be made searchable using the Configuration tool and it can change the mode(AT mode <-> GW mode).
  
- Bug Fixed
  - Class C private IP When the module IP and Remote IP is 192.168.xx.xx and third IP address is different for each, ARP request operation is not transmitted.
  
- Improvements
  - The ISR address have changed to fixed address. The ISR address of APP did no more have to need copy and use in Boot.

**DISTRIBUTORS NOTIFICATION :**

The purpose of this note is to inform changes in the Firmware of WIZ750SR-TTL/232/485, WIZ750SR-100/105/110, W7500S2E/W7500P-S2E. The purpose of all changes are for better convenience.

Please notify this change to the customers who are using the upgraded products.

**DISTRIBUTOR ACKNOWLEDGEMENT :** Distributors may use this form to acknowledge receipt of this notification. Please fill in the below form and return it to us.

Distributor		Date	
Name		Title	
E-mail			
Comments			